



Spruce Tree Revetment

Step-by-Step


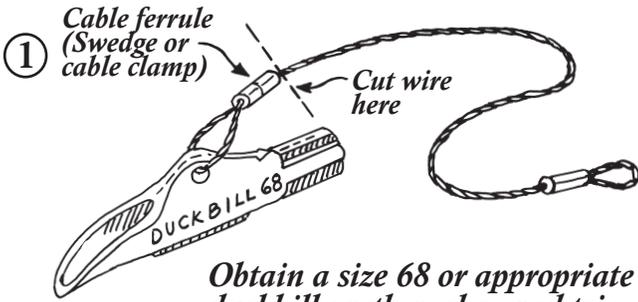


Obtain a size 68 or appropriate duckbill earth anchor and trim wire as indicated.

- ② Obtain a spool of 1/8" diameter stainless steel cable and thread through an uncrimped cable ferrule then the duckbill earth anchor.

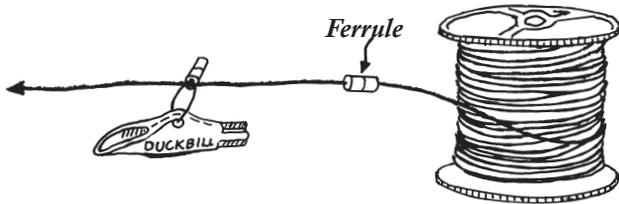


- ③ Insert driving rod into the earth anchor. Drive the anchor at a 45 degree angle into the bank to refusal. Remove rod and set anchor by pulling the cable.

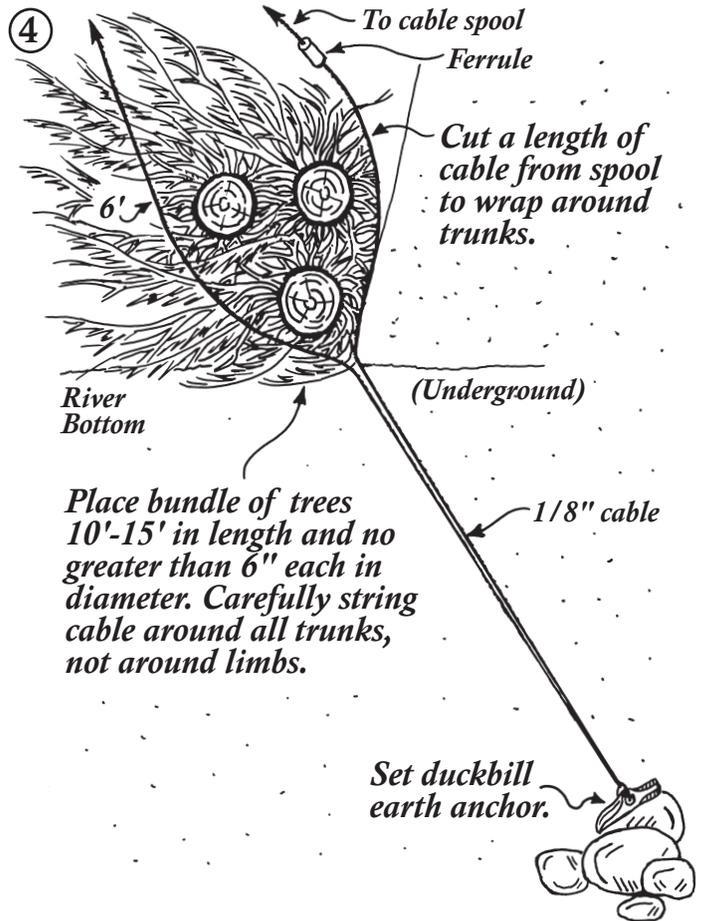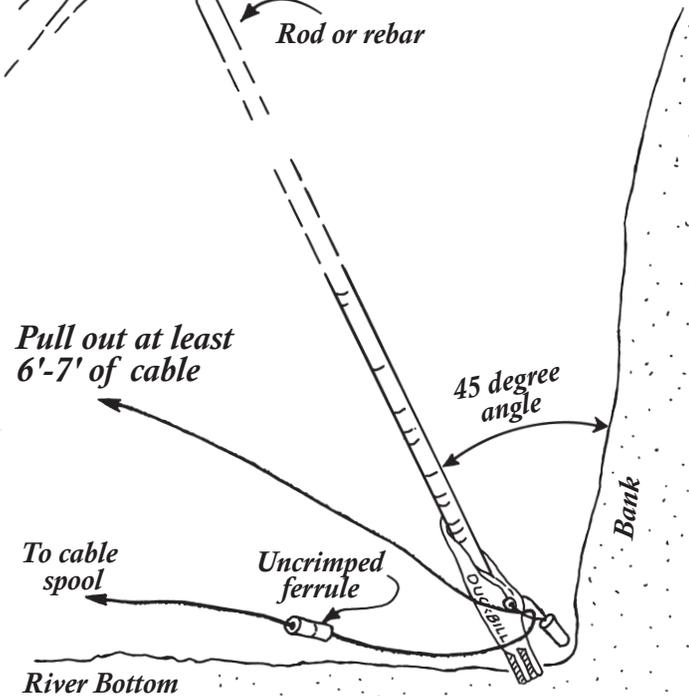

Place bundle of trees 10'-15' in length and no greater than 6" each in diameter. Carefully string cable around all trunks, not around limbs.

- ⑤ Thread loose end of cable through ferrule, compress trees and pull both ends of cable taut. Crimp ferrule.

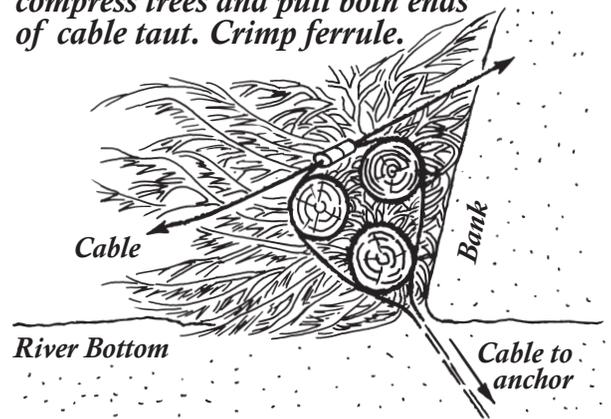

- ⑥ Cut and remove excess wire. Repeat steps 1- 6 every 4' - 6' along tree bundle length.

